

1. Top View

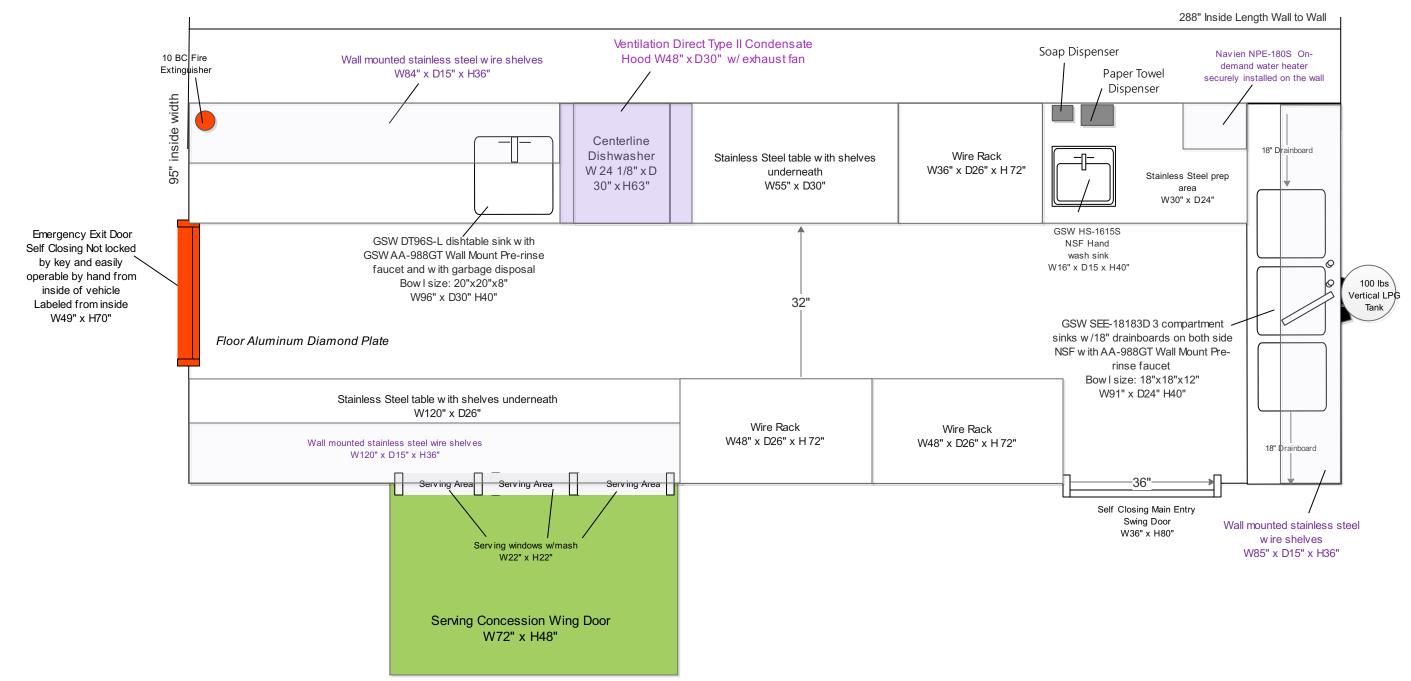

Description:

- All submitted plans are scaled of 1/2"=1'
- 1/8" Aluminum diamond plate will be used for the floor.
- Smooth aluminum or stainless steel sheet metal will be used for wall and ceiling
- 4" high 3/8" radius aluminum molding extended to the wall will be used
- NSF approved food graded silicon will be used to fill connections of cabinets, walls etc.
- Aluminum diamond plate floor will be welded to fill gaps and connections to make it water resist
- Specification sheet has been attached for all equipment used
- All stainless steel cabinets installed with security latch to ensure doors reliability while moving
- Shurf lo water pump will be used model#: 2088-422-144, water delivery range 1.5-2.8 GPM.
- Wash down hose is located under the 3 compartment sink in custom built stainless cabinet. The length of the hose is as long as the truck
- Preparation area is stainless steel smooth and cleanable
- Hand wash sink bowl size is 14" x 10" x 6"
- All appliances are NSF approved (please see NSF letters attached)
- Trailer inside height is 84"
- Shatterproof LED light will be used
- All equipment mounted securely to the framing structure and/or counter top.
- all gas-fired appliances properly insulated in a manner that will prevent excessive heat buildup and/or injury
- All equipment are sealed to floor or have minimum 6" cleaning space under.


2. Passenger Side Interior View

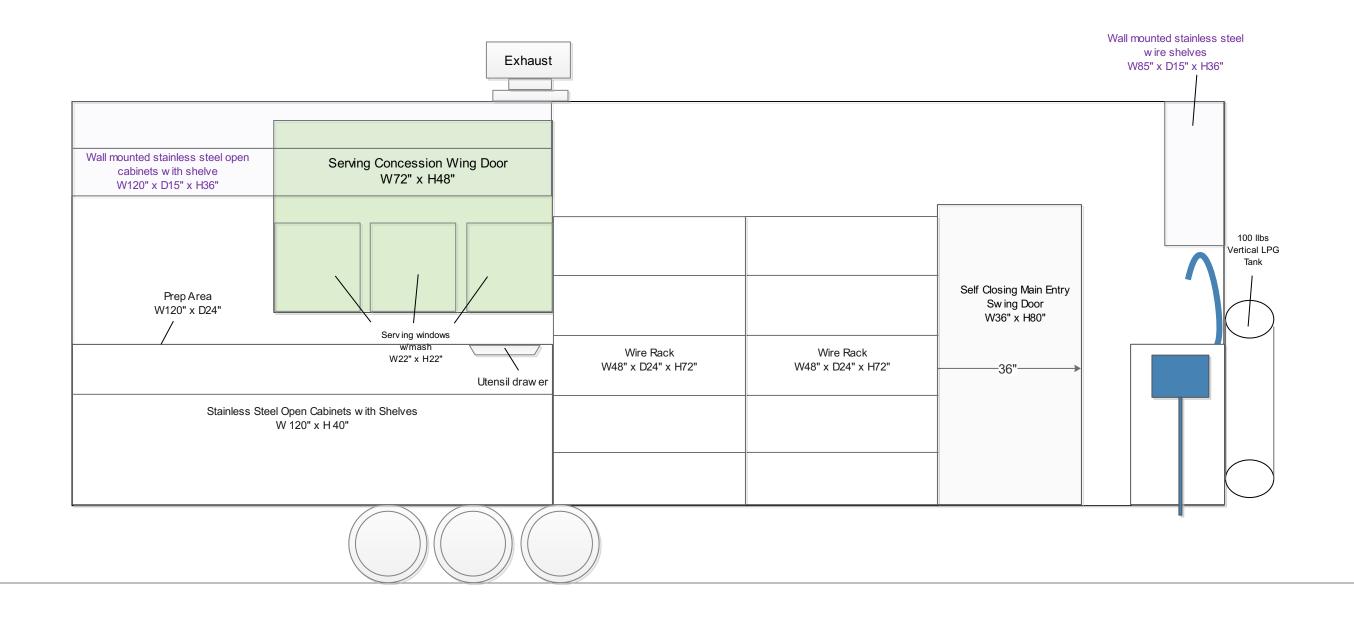


Description:

- Utensil Drawer is easily cleanable stainless steel material.
- Under sinks area will be covered with stainless steel and door.
- Washdown hose is equipped with pistol grip hose nozzle


3. Passenger Side Exterior View

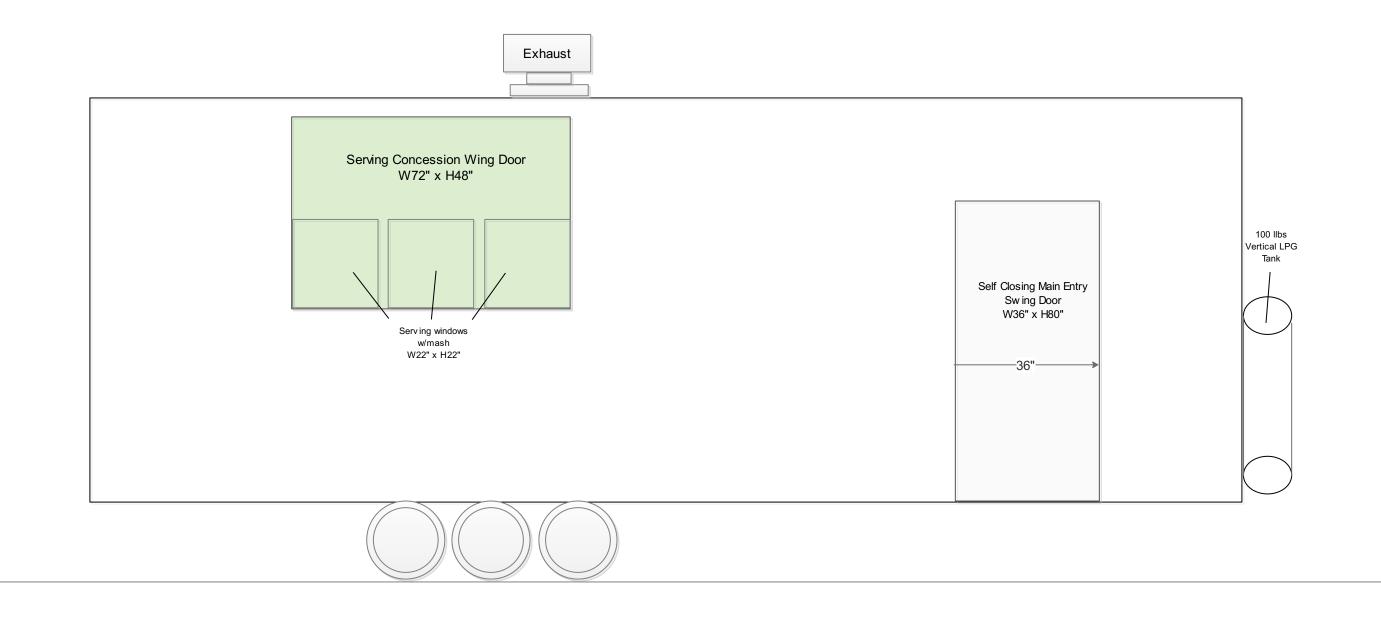


4. Driver Side Interior View

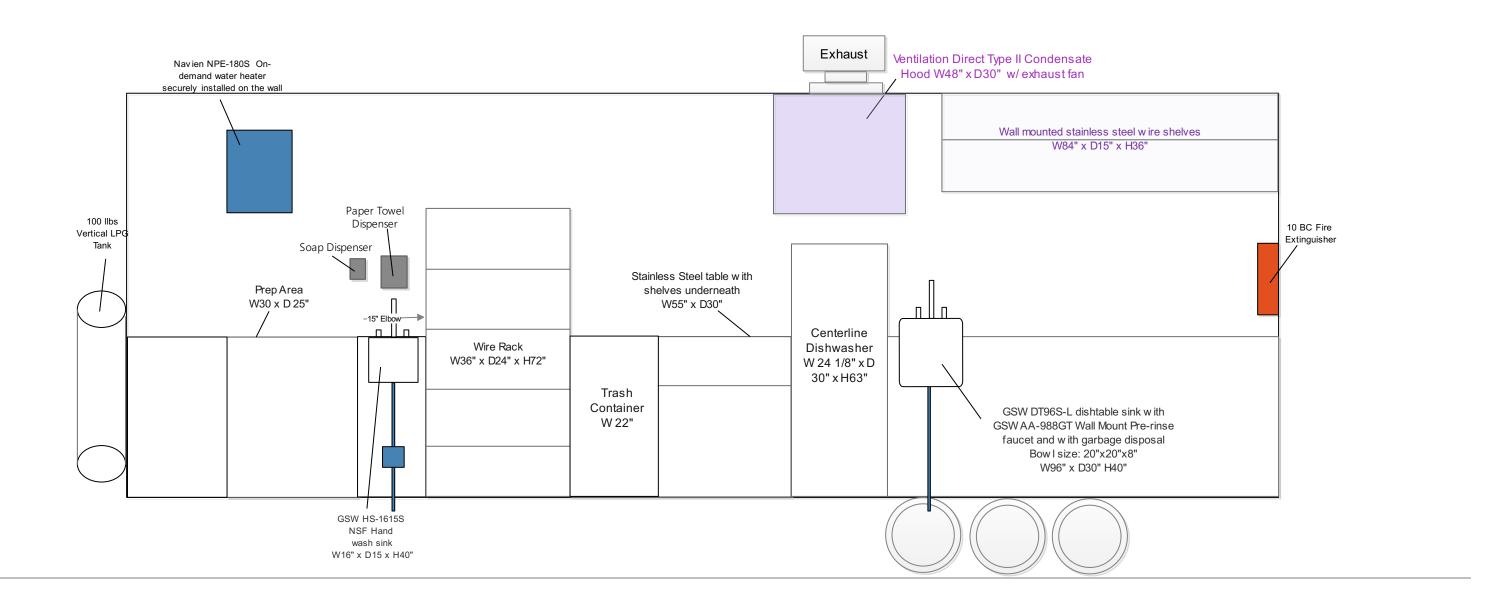


5. Driver Side Exterior View

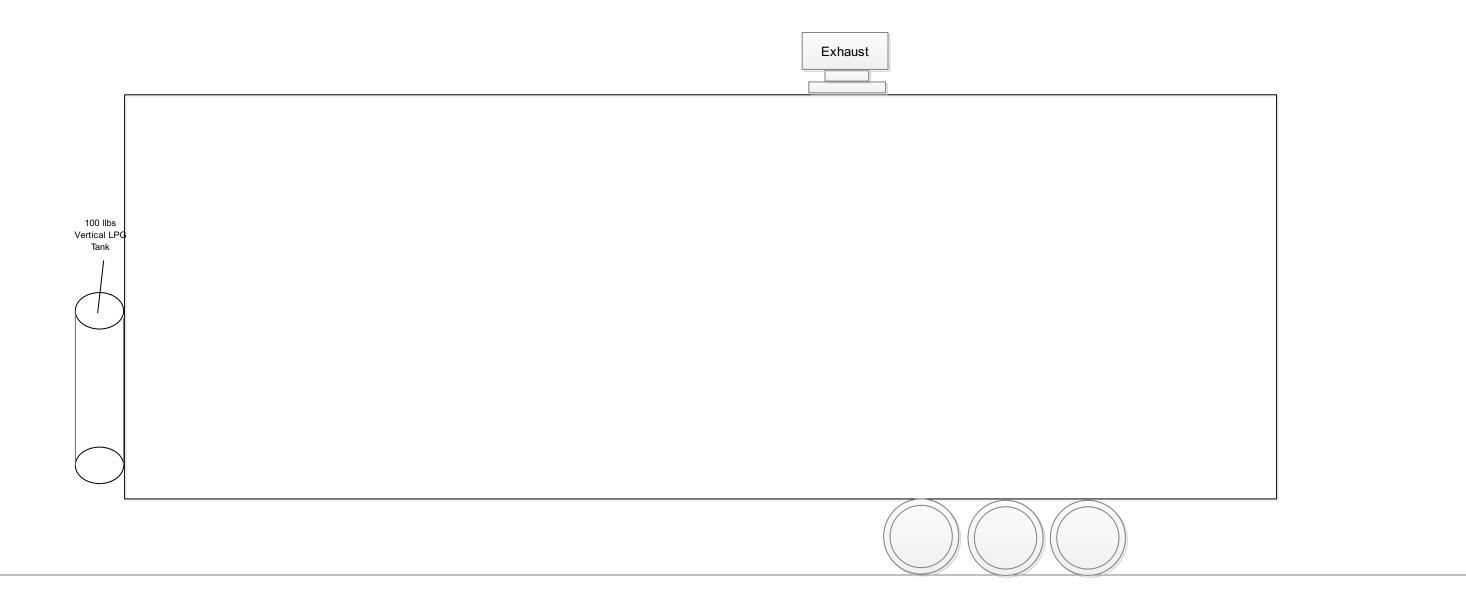

6. Plumbing View

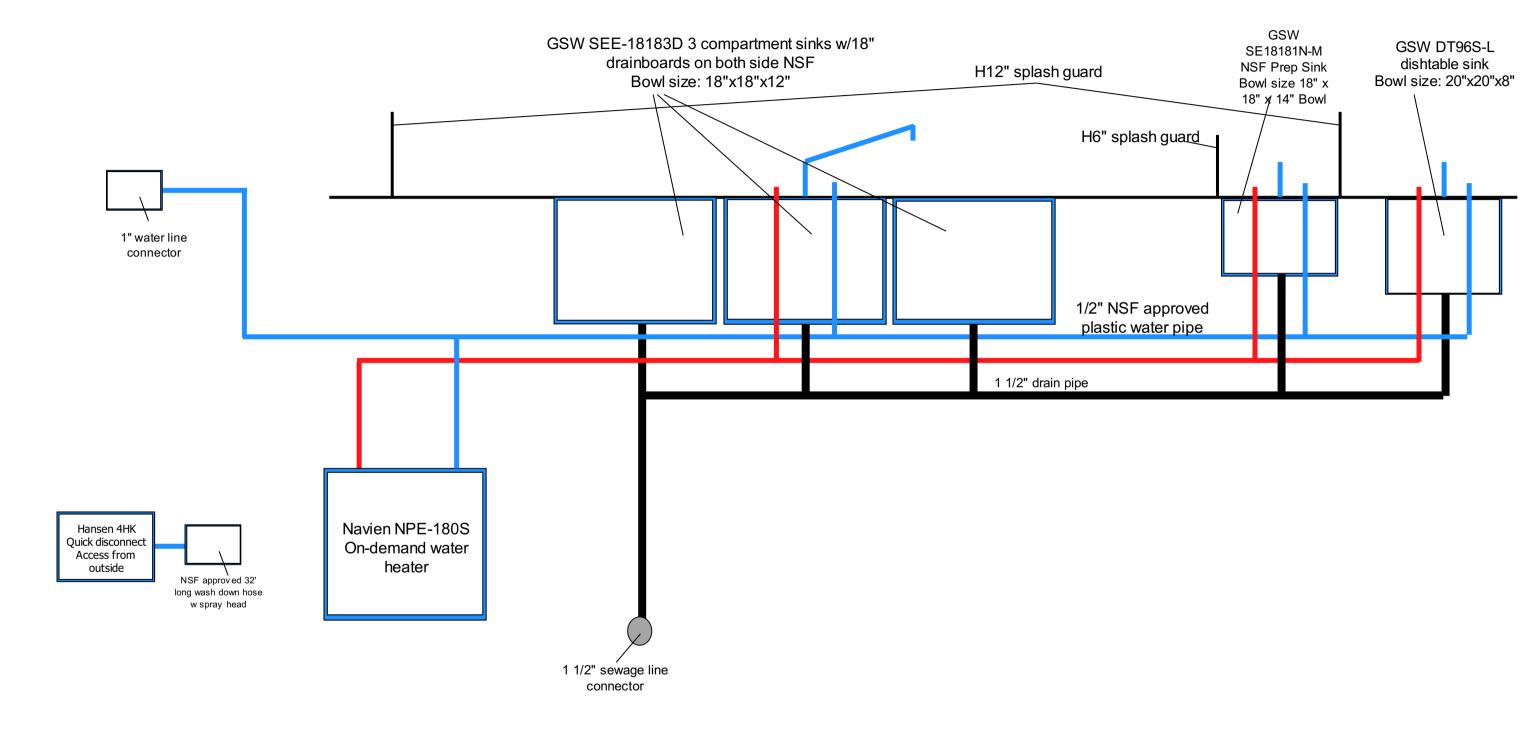

7. Front Side Exterior View

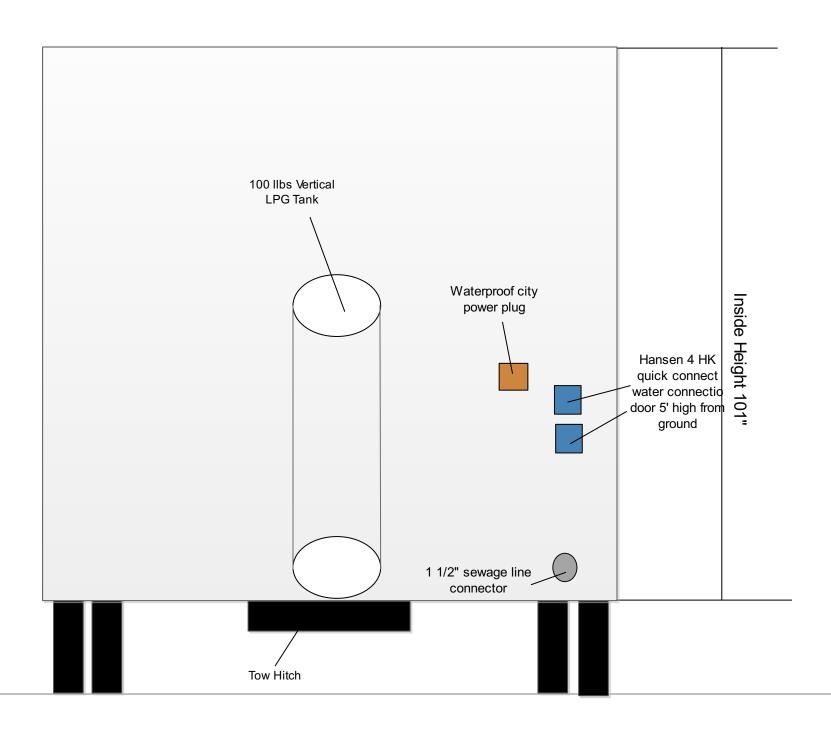

THIS VALIDATED PERMANENT TRAILER IDENTIFICATION (PTI) CARD OR A FACSIMILE COPY IS TO BE KEPT WITH THE VEHICLE FOR WHICH IT IS ISSUED. THIS REQUIREMENT DOES NOT APPLY WHEN THE VEHICLE IS LEFT UNATTENDED. IT NEED NOT BE DISPLAYED. PRESENT IT TO ANY PEACE OFFICER UPON DEMAND. PTI IS VALID FOR FIVE (5) YEARS FROM THE DATE OF CONVERSION OR FIRST OPERATION. IF YOU DO NOT RECEIVE A RENEWAL NOTICE, USE A FACSIMILE COPY OF THIS FORM TO PAY YOUR RENEWAL FEES OR NOTICE, USE A FACSIMILE COPY OF THIS FORM TO PAY YOUR RENEWAL FEES OR NOTIFY THE DEPARTMENT OF MOTOR VEHICLES OF THE NON-OPERATIONAL (PNO) STATUS OF A STORED VEHICLE.

IMMEDIATELY NOTIFY DMV IN PERSON OR BY MAIL ON THE PROPER DMV FORMS WHEN:

YOU CHANGE YOUR ADDRESS.

YOU SELL YOUR TRAILER.

YOU ARE INVOLVED IN AN ACCIDENT (WHETHER OR NOT IT WAS YOUR FAULT) WHEN THERE WAS OVER \$750 DAMAGE OR ANY BODILY INJURY OR DEATH.

WHEN WRITING TO DMV, ALWAYS GIVE YOUR FULL NAME, PRESENT ADDRESS, AND THE VEHICLE MAKE, LICENSE, AND IDENTIFICATION NUMBERS.

*********** DO NOT DETACH - PTI OWNER INFORMATION ***********

MAKE YR MODEL KAUF 2024 BODY TYPE MODEL Vehicle MP UTIL

TYPE VEHICLE USE DATE ISSUED TRAILER 06/05/24

CALIFORNIA MOBILE KITCHENS

PERMANENT TRAILER IDENTIFICATION CARD

YR 1ST SOLD VLF CLASS 2024 EP FF 2

WC UNLADEN WT E 05210 CC/ALCO DT FEE RECVD 40

PIC 06/05/24

TYPE LIC PA

LICENSE NUMBER 4WB7191 VEHICLE ID NUMBER

\$ 1785.00

7UZEN2422RD006753 USE TAX 1738

EXP DATE: PERM AMOUNT PAID

AMOUNT DUE AMOUNT RECVD \$ 1785.00 CASH :

CHCK : 1785.00

CRDT :

5

TYPE VEH

41F

PASO ROBLES CA

PO BOX 2307

REGISTERED OWNER

93447

LIENHOLDER

C00 VC8 FF 0178500 0002 CS C00 060524 PA 4WB7191 753



© 2022, T.R. Arnold & Associates, Inc.

T.R. ARNOLD & ASSOCIATES, INC. • Engineering • Plan Review • Inspection •

Form 401 Issued 03/21/2012 Revised 05/11/2022

	INS	SPECTION REPO	ORT Work (Order No. 24-02507
Manufacturer L A SI	-ainless	Kings	Client No. 72/9	Date 6/7/2024
Plant Location 897	6 coman	nche AUL	CHATS W	orth CA
Inspector G-r-co	EDWATE	Accompa	anied By: TIKIQ	Hervath
rate of Froduction 2	- Month	Labels Controlled by:		RA
For Office Use only Defects Logged		Lumber Trusses Plywood Particleboard Insulation Doors Windows	Tests Observed Gas High Pressure Gas Low Pressure Electrical Continuity Electrical Operationa Electrical Polarity Dielectric Strength Water Supply DWV Fixture Egress Window Ope Equipment	
Labeled Yard Units Inspected			Miles Com	1 11 11 (1067/
Unlabeled Yard Units - Check All other units re-inspected fo	ced Status of Q.C. Record	ious 402/s? Yes No		of unit tested 4067/
All other units re-inspected to	T AND RECORD ALL U	NLABELED YARD UNITS AN	ND DEVIATIONS ON FORM	401 & 402
	AL NUMBER MODEL		ER/DATE	DESTINATION
F. NaL 10006		Visual	Appress	The was lettered
Spcm 4067.	,	*	ATUS	Harver Wax Ca Diro CA 93422
30	Tra, 12		7/200	93422
			V:N# 7UZE	ENZ4ZZRD00675
		AS PODENCED BY THIS INSIGNIA TH COMPLIANCE WITH THE CA HEALTH AND CA CODE OF REGULATIONS TITL PURPOSE COMMERCIAL MODULAR (COMMERCIAL MODULAB BEARING A HAVE ITS FIRE AND LIFE SAFETY, PL	DRNIA DEPARTMENT OF IUNITY DEVELOPMENT ES AND STANDARDS IHE MANUFACTURER CERTIFIES TO H AND SAFETY CODE DIV. 13, PART 2 TILE 25, CHAPTER 3 FOR SPECIAL 3C CONSTRUCTION. A SPECIAL PURPOSE A DEPARTMENT INSIGNIA SHALL NOT PLUMBING, ELECTRICAL, OR IALLATIONS ALTERED OR CONVERTED INED FROM THE DEPARTMENT.	SELLER CERTIFIES 70 COMPLIANCE





T.R. ARNOLD & ASSOCIATES, INC. • Engineering • Plan Review • Inspection •

INSPECTION OBSERVATION REPORT

LA	55a	inla	.05	K	inc	
MANUFA	CTURER	AND P	LANT	LOC	ATION	

CHATSWORTH 6/7/2024
Date

Page Z Of Z

SERIAL NUMBER	DAPIA/CCI/MCI CODE REF.	OBSERVATIONS/COMMENTS
000673		This Inspection is Fer The State
		of california spen.
		This war is is ier Emergency
		Diraria relat. This unit only
		walter poster There is a c Frechwat
	cr	Gray water Tounks pur to the high
		DICHES, IT W'II BE Hooked up to
		With Whilites When in uce
		CHecked Sinks Pis Hwarthy
		Gar Base Pilporal Tankles ware
		Heatre main Elerand papel
	MCI 51.1	DePiciancias;
1)	31,/	The Air intake and the EX haus T
		For Tanklers War - beath Ware To
		clock 3 inchis part They mind to B
		36 inches - His was Fixed and removed

I have reviewed the issues presented and instituted procedures for correction of non-conforming items. HONVOT

Manufacturers Representative

The above report is a true and accurate account of the issues noted to the best of my knowledge.

Inspector

Inspection time ZH/RJ